





MODEL #1829

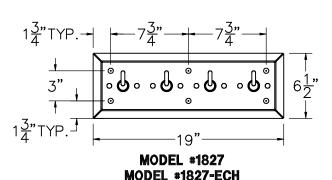

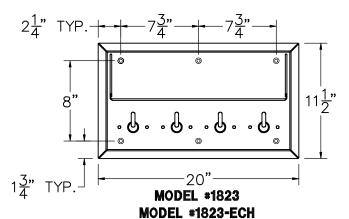

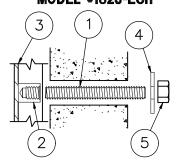


MOUNTING DETAIL FOR 1/4' STUDS

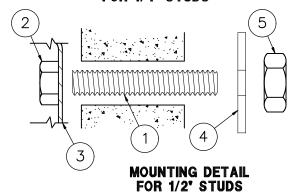

REFERENCE DRAWINGS			
-SW Wall Sleeve	9925-292-001		
Mounting Hardware	9957-900-001		

INSTALLATION INSTRUCTIONS:


- A-HAND TIGHTEN MOUNTING STUDS 1 INTO MOUNTING NUTS 2 ON BACK OF FIXTURE.
- B-POSITION FIXTURE ③ ON CELL SIDE, SLIDING STUDS ① THROUGH SLEEVE OR WALL OPENINGS.
- C-PLACE WASHERS 4 OVER STUDS 1. THREAD NUTS 5 TO STUDS 1, & TIGHTEN. DO NOT ALLOW STUDS 1 TO TURN AND THREAD FURTHER INTO MOUNTING NUTS 2. NOTE: DO NOT EXCEED 6.5 FT/LBS MAXIMUM TORQUE ON 1/4" NUTS 5.





BOTH VIEWS ARE FROM CELL SIDE

SHADED AREAS ARE REQUIRED WALL OPENINGS

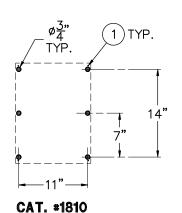



 $\phi_{\frac{3}{4}}^{3}$ $\phi_{\frac{1}{4}}^{3}$ $\phi_{\frac{1}{4}$

Ø 3 " 1 TYP.
TYP.
-7"-14"

CAT. #1812/LR1812-SLPT

CAT. #1821 & 1822

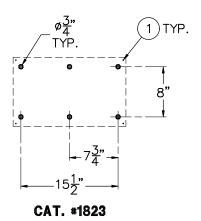

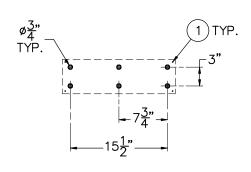


CAT. #1825 & 1827

INSTALLATION INSTRUCTIONS:


SLEEVES ARE INSTALLED IN FORMS USING NAIL HOLES

1 PROVIDED OR GROUTED INTO BLOCK WALLS BECOMING
A PERMANENT PART OF THE WALL.

NOTE: FOR POURED WALL CONSTRUCTION, TEMPORARY BRACING SHOULD BE INSTALLED WITHIN OPENING TO PREVENT DEFORMATION TO SLEEVE WHICH MAY OCCUR DURING POUR. DO NOT POUR CONCRETE DIRECTLY ON TOP OF WALL SLEEVE. THE OPENINGS ARE CAPPED; THESE CAPS 2 MUST BE REMOVED FROM THE CHASE SIDE OF THE WALL SLEEVE BEFORE INSTALLING FIXTURE.



B- WHEN SLEEVES ARE NOT AVAILABLE BLOCKOUT WITH DIMENSIONS SHOWN.

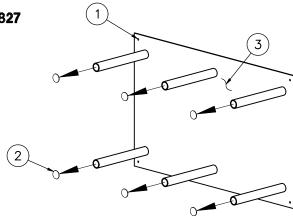

#1823 SHOWN FOR REFERENCE SCALED x 2

P.O. BOX 3527 Industry, CA 91744 15125 Proctor Ave Industry, CA 91746 (626) 336-4561 FAX (626) 961-2200	WALL SLEEVES - CAT. #1810, 1812, 1821, 1822, 1823, 1825, LR1812-SLPT		
	MANUFACTURE DATE	DATE ISSUED	DRAWING NUMBER
	DECEMBER 1971	03/01/90	
7/6	TO PRESENT	DATE REVISED 10/22/24	9925-292-001